

Quality Control Report

Consultant **Wahib Medanat** Consultant Engineers
Site Name **Um Al Dananir Basic Mixed - Balqa**
Package **Package 1**
Contractor **Derar Saraireh & Sons for Engineering & Contracting**
Tender No. **1/2020/USAID/SKEP/3/1**

Rep No. **QC-11 10**
Date **11 / 08 / 2021**

Description of Non Conformance	Corrective Action	Required by / When
<p>1. The Consultant observed that the Contractor conducted back-filling work without doing the appropriate insulation work. NCR by Medanat site engineer was issued in this regard. The Contractor was instructed to remove the back-filling to execute the required insulation (bitumen paint and waterproofing sheets including the carton sheets) as per contract and the instruction of Supervision site engineer. During the site visit, Engineer representatives observed that remedy works was ongoing</p> <p>2. Building of block walls without using fixation accessories.</p> <p>3. Building stones which do not comply with the approved sample in relation to the length and texture.</p> <p>4. Steel reinforcement stock at site rusted, oil on surface and other dirt.</p> <p>5. Plastering work without surface preparation.</p>	<p>1. Removing back-filling, applying 3 coats cold fluid insulation and the bitumenous membrane, then work shall be inspected.</p> <p>2. Removal and rebuild using fixation accessories.</p> <p>3. Removal and rebuild using complied stones.</p> <p>4. Sandblasting for the steel reinforcement.</p> <p>5. Surface preparation before replastering.</p>	<p>The Contractor/Immediately</p>

Report Prepared by

Hassan Shaqbua, Supervision
 Quality Control Manager

Contractor's Response

Immediate response by Contractor on all above remarks.

Notes

Consultant Site Engineer

Contractor Site Engineer

Signature

Signature

Quality Control Report

Before Photos:



Conducting back-filling work without doing the appropriate insulation work



Starting remedy work in the presence of Engineer representatives

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Steel Reinforcement

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Blockwork

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Surface Preparation



Surface Preparation

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Stone Building



Stone Building

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report

Photos After:



Remedy work has been finished (removing back-filling and applying waterproofing membrane as per specification)



Steel Reinforcement

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Steel Reinforcement

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Surface Preparation

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Surface Preparation

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



removal of un-complied blockwork

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



removal of un-complied Stone

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature