



SKEP III Home Office Support Site Visit Report

**WAHIB
MEDANAT**
consultant engineers

Consultant	Wahib Medanat Consultant Engineer	Rep No.	22-03062021
Contractor	Dijlah Establishment Constr. Contracting	Tender No.	(11/2019/USAID/SKEP/3/S) Schools for a Knowledge Economy Project (SKEP) - Phase (3) Package (1, 2)
Site Name	Thahr Al Sarow Basic School for Boys- Jerash	Day/ Date	Sat. 03/06/2021
Duration of Project	450 Calendar Days	Total Project Budget	8,314,983.735 JD

No.	Visitors		Remarks
1	Suhair Amarin	- Project Dir./Head of Architectural Department	
2	Omar Elayan	-Senior Civil Engineer	
3	Akram Khammes	- Head of Electrical Department	
4	Marwan Sonna'a	-Head of Mechanical Department	
5	Hasan Shaqboua	-Quality Control Manager	

Visit Notes

No.	Description
1	1- Blockwork: The quality is acceptable in general. Narrow spaces must not be filled with mortar. Saw cut blocks must be used.
2	2- Window jambs: The end of blockwork with all details such as polystyrene should be ended at the openings with concrete edge not thin layer of mortar as observed.



No.	Description
3	<ul style="list-style-type: none">- Quality check for the stone mock-up wall (not pointed).• Window sill shall be two pieces not three.• Broken edges were noticed. The stones must not have broken edges.• The window stone frame must look as one piece. The pieces should be cut and built with more care for joints.• No objection to the place of installing the electrical boxes on a condition to be installed in a way to avoid cut in the pointing of spaces between built stone layers.• Number of broken stones were observed. Broken stones are not accepted and must be replaced and this to be avoided in executing the stone elevations. <p>Sample for stone pointing must be prepared in a later stage to be checked by the Engineer on the request of the Contractor.</p>



Project ID
Sign on Site





Temperature check, sterilization and signing visitors' attendance sheet at the entrance of the site, complying with Covid-19 Protocol



Quality check for the stone mock-up wall (not pointed). Notes were given to the contractor



The window stone frame must look as one piece. The pieces should be cut and built with more care for joints



Number of broken stones were observed.



The Contractor was instructed to rectify the status of this end for window jamb by casting concrete section instead of block and mortar



Narrow spaces must not be filled with mortar. Saw cut blocks must be used
Narrow spaces must not be filled with mortar. Saw cut blocks must be used



First stage of plastering work



Tour inside the site was conducted

