

Quality Control Report

Consultant **Wahib Medanat** Consultant Engineers
Site Name **Al Khansa'a Basic Mixed - Balqa**
Package **Package 1**
Contractor **Derar Saraireh & Sons for Engineering & Contracting**
Tender No. **1/2020/USAID/SKEP/3/1**

Rep No. **QC-12 05**
Date **16 / 08 / 2021**

Description of Non-Conformance	Corrective Action	Required by / When
<p>1. Due to thicker points in ceiling plastering, part of the mortar fallen down from number of points. 2. Roughness was observed at number of columns. 3. Stone building without using fixing accessories. And, joints between stones for window soffits are wider than required. 4. MEP cabinets installation by destroying parts of the built blockworks.</p>	<p>1. Repairing by removing the loose parts, rework in layers. 2. Repairing using the approved materials. 3. The wrong built stones were removed and replaced with fixing accessories. 4. Casting a lintel over the cabinets and casting concrete around where needed.</p>	<p>The Contractor/Immediately</p>
<p>Report Prepared by</p>	<p>Hassan Shaqbua, Supervision Quality Control Manager</p>	
<p>Contractor's Response</p>		
<p>The contractor response is still limited. He rectified the work regarding point 3 and partially for point 4.</p>		
<p>Notes</p>		

Consultant Site Engineer

Contractor Site Engineer

Signature

Signature

Quality Control Report

Before Photos:



Defects in Plastering



Wide joints in stone soffit

Consultant Site Engineer

Contractor Site Engineer

Signature

Signature

Quality Control Report



Mechanical Cabinets Installation

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Fixation of Stone at One Area

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Case of Mechanical Cabinets installation

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Column Roughness

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report

Photos After:



Sample of Stone Fixation

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Sample of Acceptable Stone Building

Consultant Site Engineer

Contractor Site Engineer

Signature

Signature

Quality Control Report



Starting to rectify Mechanical Cabinets Installation

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature