

Quality Control Report

Consultant **Wahib Medanat** Consultant Engineers
Site Name **Jumana Bint Abi Taleb Basic Mixed - Marka**
Package **Package 2**
Contractor **Dijlah Est. Construction Co.**
Tender No. **10/2019/USAID/SKEP/3/2**

Rep No. **QC-23 07**
Date **11 / 08 / 2021**

Description of Non Conformance	Corrective Action	Required by / When
<p>Stone:</p> <ol style="list-style-type: none"> Gaps between stones due to stone height differences have to be unified. Chesseling pattern has to be unified for all stones as per approved sample. Eexecuting the second plastering layer before executing the first plastering layer. 	<ol style="list-style-type: none"> Gaps to be rectified where possible (replacing stone pieces of different heights). Stones not complying with sample has to be removed. Incorrect execution of plastering: <ol style="list-style-type: none"> Removing the second plastering layer and executing the first plastering layer according to site engineer instrucionts. Performing the nessesary curing. Re-executing the second layer as per specifications. 	<p>The Contractor/Immediately</p>
<p>Report Prepared by</p>	<p>Hassan Shaqbua, Supervision Quality Control Manager</p>	
<p>Contractor's Response</p> <p>The Contractor is responding to each mentioned point as follows: Point.1: Corrective action has been taken. Point.2 : The Contractor is not repsonding. Point.3 : The Contractor responded positively and promptly and executed as per the required process. (Photos are attached)</p>		
<p>Notes</p>		

Consultant Site Engineer

Contractor Site Engineer

Signature

Signature

Quality Control Report

Before Photos:



Remarks on the stone work as per report

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Stones of Different Heights

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Removal of non-complying stone

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



Executing second plastering layer before the first plastering layer

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report



The Remedy Process

Consultant Site Engineer

Signature

Contractor Site Engineer

Signature

Quality Control Report

Photos After:



Consultant Site Engineer

Signature

Contractor Site Engineer

Signature