

Rep No. QC-23 02 Wahib Medanat Consultant Engineers

Jumana Bint Abi Taleb Basic Mixed - Marka **Site Name Date** 24 / 02 / 2021

Package Package 2

Contractor Dijlah Est. Construction Co. Tender No. 10/2019/USAID/SKEP/3/2		
Description of Non Conformance	Corrective Action	Required by / When
1. Over used shuttering woods for	Defected parts need to be replaced	The Contractor is Requested to Take Action to Repair All Stated Defects
ground beams.		Under Close Follow Up by The Supervision Site Staff. Action is
2. Damaged cartonal boards in several parts	2. Damaged boards need to be replaced	
3. Weak fixing of cartonal boards led		
to accumalating backfilling materials	3. Remove boards, clean and fix properly new boards	
between those boards and the concrete		
members.		
4. Number of electromechanical pipes have	4. Remove broken parts, repair, fix properly	
broken ends. Electrical first fix pipes were		
obsereved at the face of casted wall	Protect all pipes permanently.	
5. Two points in casted concrete were	5. Repair using approved materials	
observed having segregation and broken ends		
6. Boulders were observed in backfilling	6. Remove all boulders	
material	1	
Report Prepared by	Hassan Shaqbua, Supervision Quality Control Manager	
Contractor's Response		
The Contracor started with repair on the same day.		
Notes		



































