

# Quality Control Report

**Consultant** **Wahib Medanat** Consultant Engineers  
**Site Name** **Hay Al Iskan Basic mixed - Jerash**  
**Package** **Package 2**  
**Contractor** **Dijlah Est. Construction Co.**  
**Tender No.** **10/2019/USAID/SKEP/3/2**

**Rep No.** **QC-21 04**  
**Date** **11 / 03 / 2021**

Description of Non Conformance	Corrective Action	Required by / When
<p>The contractor started installing steel reinforcement bars for the slab on grade before finishing the preparation work and the removal of back-filling material around the top steel reinforcement of the ground beams which will be casted along with the slab on grade. Number of steel bars of the grade beams were defected due to back-filling work and became unarranged which need to tidy up and while some need changes (Photos Attached).</p>	<p>The steel bars laid for slab on grde should be removd and all the backfill should be removed from the top of the beams and the defected steel bars should be replaced. All steel bars to be arranged well as per drawings and to the approval of the supervision engineer.</p>	<p>The contractor was requested to take action immediately.</p>
<p><b>Report Prepared by</b></p>	<p>Hassan Shaqbua, Supervision Quality Control Manager</p>	

### Contractor's Response

The contractor responded immediately and started with remedy work. The work will be inspected by supervision.

### Notes

Consultant Site Engineer

Contractor Site Engineer

Signature

Signature

# Quality Control Report



Defected Works- QC Report 2104



Corrective Action- QC Report 2104

Consultant Site Engineer

Contractor Site Engineer

Signature

Signature